

实验室安全检查通报

东北林业大学 实验室管理与条件保障处

检查内容：实验室安全检查

检查时间：2025年3月12日、2025年3月19日

检查范围：生命学院科研实验室

检查人员：郭敏、李凯、校级实验室安全督查员

生命学院：

3月12日、3月19日分别对生命学院的科研实验室进行了检查，现场检查中发现在化学品管理、加热仪器设备管理、用电基础管理等方面存在安全隐患，请学院务必加大实验室安全检查督查力度，进行彻底细致地安全检查，确保实验室安全稳定运行。在现场检查中发现存在以下具体问题，见表1。

表1 检查中发现的实验室安全管理中存在的问题

| 检查日期 | 实验室 房间号 | 检查问题记录 |
|------------|------------|--|
| 2025年3月12日 | 逸夫教学楼201 | 1、正己烷未低温保存； 2、试剂柜内化学品未规范存储，化学试剂叠放； 3、实验室内堆放大量易燃品（如纸箱）存在消防安全隐患。 |
| 2025年3月12日 | 逸夫教学楼306 | 1、接线板串联； 2、接线板未进行有效固定。 |
| 2025年3月12日 | 逸夫教学楼313 | 1、烘箱内物品叠放； 2、违规操作烘箱，直接将物品置于加热板上。 |
| 2025年3月12日 | 逸夫教学楼332 | 1、试剂柜内化学品未规范存储，化学试剂叠放； 2、实验室化学品超量存放（单一包装容器不应大于20L或20kg）； 3、自配试剂未张贴完整清晰的试剂标签。 |
| 2025年3月12日 | 逸夫教学楼602 | 1、废液桶无标签，没有标明废液成分，无防渗漏托盘及废液回收区安全警示标识。 |

| | | |
|------------|---------------|---|
| 2025年3月12日 | 逸夫教学楼605 | 1、实验台面摆放多瓶娃哈哈水瓶，未张贴成分标签。 |
| 2025年3月12日 | 逸夫教学楼3楼 走廊 | 1、加热设备置于走廊，影响防火通道的畅通； 2、加热设备遮挡配电箱； 3、电源虚接，轻触出现电火花，存在用电隐患； 4、走廊存放摇床等多台设备，且多台设备共用一个接线板，存在用电过载隐患。 |
| 2025年3月19日 | 逸夫教学楼313 | 1、管制类化学品存储不规范，未按配伍禁忌存储，易制爆药品(高氯酸)与酒精等化学试剂混放；易制毒药品(三氯甲烷)未专柜存储、无药品标签、无登记台账； |
| 2025年3月19日 | 逸夫教学楼228 | 1、实验室布局不合理，学习区与实验区没有明确区分。 |
| 2025年3月19日 | 逸夫教学楼201 | 1、管制类化学品台账记录不规范。 |

请学院督促以上实验室立即进行整改，并撰写整改报告（整改报告模板见实验室管理与条件保障处网站<https://elab.nefu.edu.cn/info/1052/1633.htm>），于**3月28日**前提交实验室管理与条件保障处备案，其他实验室举一反三，排查问题，杜绝隐患。

办公地点：行政楼 604

办公电话：82190708

实验室管理与条件保障处

2025年3月24日

实验室安全隐患图

| 实验室名称 | 隐患图 |
|-------|---|
| 201 |  <p>The images for laboratory 201 show several safety hazards. The top row contains four photos: 1) A shelf with several bottles, some with labels, and a plastic bag. 2) A shelf with many small bottles and containers, some in plastic bags. 3) A shelf with large blue-capped bottles. 4) A microwave oven (美的微波炉) on a shelf with boxes and other items. The bottom row shows a larger view of a cabinet area with several cardboard boxes stacked on top, one labeled '植物组织' (Plant Tissue).</p> |
| 306 |  <p>The images for laboratory 306 show electrical safety hazards. The left photo shows a power strip plugged into a wall outlet with multiple cables plugged into it. The right photo shows a power strip plugged into a benchtop outlet, with several cables plugged into it.</p> |
| 313 |  <p>The images for laboratory 313 show laboratory storage areas. The left photo shows a shelf with many stacks of petri dishes and bottles. The right photo shows a shelf with many stacks of petri dishes and a plastic bag.</p> |

332



602




605



3楼走廊



313

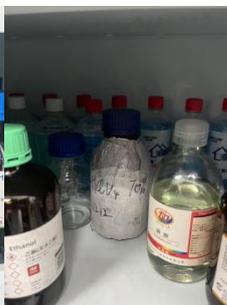

228

